Macromedia - Developer Center: Flash Video Template: Corporate Video Presentation - Microsoft Interne...

Problem
Control cabinet appears to have no power (does not enter cooling down when switched on)



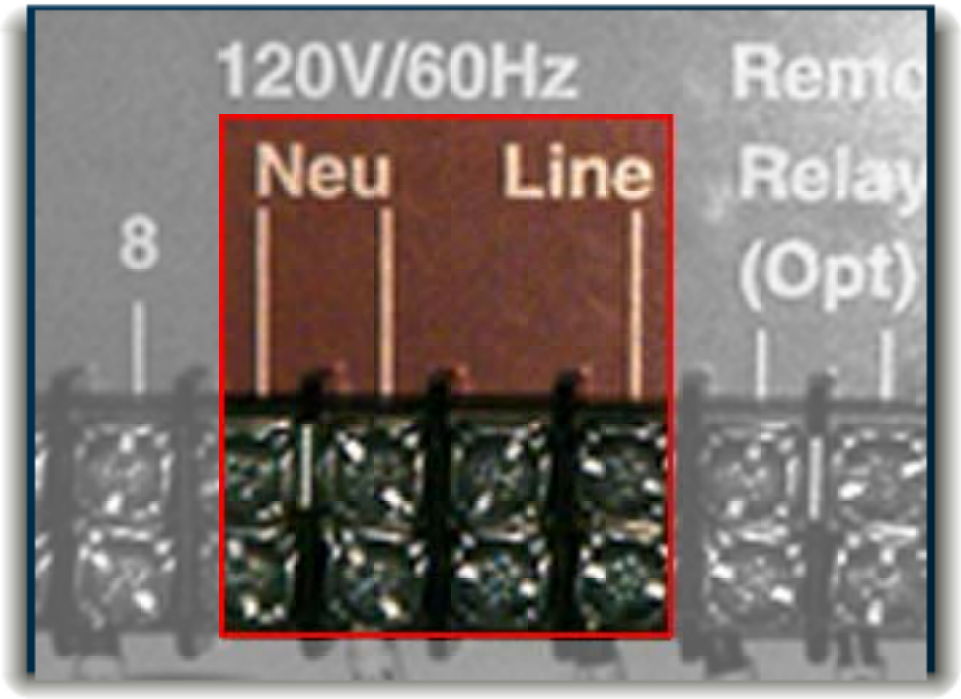

REASON 1
No power to the purger.
SYMPTOM
The ON and PURGER COOLING DOWN lights are not illuminated.
CHECK
The LINE and NEUTRAL terminals inside the control cabinet should have 115V (230V for 230V purger) across